





 
 
 


TOR REY ELECTRONICS
CALIBRATION PROCEDURE FOR **SR-50/100**

1. PUT THE SCALE IN A PLACE FREE OF ANY MOVEMENT OR VIBRATION.
2. MAKE SURE THAT THE SCALE IS LEVELED AND WELL SUPPORTED ON ITS FOUR BASES; CONNECT THE SCALE TO A 120 VAC OUTLET.
3. TURN THE SCALE ON AND DURING THE COUNTDOWN PRESS THE PUSH BUTTON LOCATED BEHIND THE SILVER COVER ON THE BACK OF THE SCALE.
4. THE INDICATOR SHOULD READ "CODE". NOW ENTER THE CALIBRATION PASSWORD      , AND PRESS THE  KEY.
5. THE SCALE WILL READ "RZERO". NOW WITH NOTHING ON THE SCALE PRESSE THE  KEY. THE SCALE WILL DO A COUNTDOWN FROM 5 AND THAT IS YOUR REFERENCE TO ZERO.
6. NEXT THE SCALE WILL READ "LOAD". NOW PLACE 50 LBS ON THE SCALE AND PRESS THE  KEY. THE SCALE WILL DO A COUNTDOWN FROM 5.
7. WAIT A MOMENT. DO NOT REMOVE THE WEIGHT FROM THE SCALE UNTIL A NUMBER APPEARS IN THE INDICATOR.
8. NOW REMOVE THE WEIGHT FROM THE PLATE AND TURN THE SCALE OFF. IN THIS MOMENT THE SCALE HAS BEEN CALIBRATED.
9. VERIFY THE ACCURACY IN THE WEIGHT AND REPEAT THIS PROCEDURE IF NEEDED.