
ELECTRICAL

LINIT IS SHIPPED THREE PHASE AND IS FIELD CONVERTIBLE TO SINGLE PHASE

MODEL	VOLTS	WATTS	AMPS PER LINE 3 PHASE			AMPS SINGLE	FIELD WIRING GAUGE		TEMP.
			L1	L2	L3	PHASE	3 PHASE	1 PHASE	RATING
MOD-300TDM/AF	208	3720	10.3	10.3	10.3	17.9	12 AWG Cu	10 AWG Cu	75°C
MOD-300TDM/AF	240	4950	11.9	11.9	11.9	20.6	12 AWG Cu	10 AWG Cu	75°C

INCHES (MM)

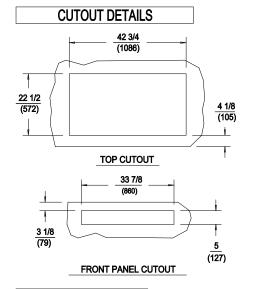

CLEARANCES

MINIMUM CLEARANCE REQUIRED UNIT TO THE NEAREST SURFACE							
BACK	SIDE	воттом	FRONT				
1	1	6 3/4	4 1/8				
(25)	(25)	(171)	(105)				

INSTALLATION INSTRUCTIONS

INSTALLER MUST MEET CONDITIONS OF ACCEPTABILITY OUTLINED BELOW UPON INSTALLATION:

1. Required installation clearances:
Wooden and Metal Installation: DO NOT install closer than
4 1/8 inches to front wall, 1 inch to back and side walls, and 6 3/4 inches to surface below the unit. If the control box is located below the unit, the front clearance may be

2. Unit shall be accessible for servicing from the bottom.
3. If storage is to be used underneath the unit, it is recommended that a baffle be placed 8 1/2 inches below the unit to avoid contact with elevated temperatures.
4. For water and waste connections: This appliance is to be installed to comply with the applicable federal, state or local plumbing codes.

TO FABRICATE:

Lay out cutout dimensions on countertop and front


2. Lay out and fabricate control panel holes in counter apron using the control box as a template. 3. Cut out holes.

TO INSTALL:
IMPORTANT - DO NOT disconnect lead wires from the
Master Control Panel when making installation.

1. Tilt and pass Control Panel and electrical box through
the countertop cutout, then through the apron cutout.
Lower modular section into countertop cutout and position.
RECOMMENDATION: Before final seating of modular section
to countertop, apply a bead of silicone adhesive/sealant
to the underside of gray gasket material supplied on the
mounting flange. nounting flange.

2. From underneath, insert screwdriver into slots in Wellslock frame and twist ears outward (clockwise) as required to secure flange tightly to countertop.

3. Mount Control Box to apron cutout as shown in drawing.

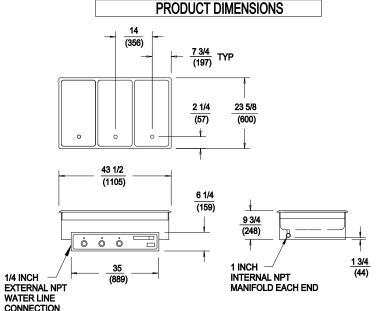

4. Mount Control Panel onto electrical box using the screws supplied.

TO PLUMB:

TO PLUMB:

1. A drain manifold complete with valve is supplied on all models except MOD100TD. Location of valve handle is at the discretion of the fabricator (see drawing).

2. Connect 1" drain connection to suitable drain line.

3. Connect 1/4"NPT water supply to Solenoid valve in Outlet Box. Note: Maximum pressure 120 psi, maximum temperature 120°F. A backflow preventor is incorporated in the unit, between the water fill solenoid and pan. Local codes may require an additional vacuum break device. (Not provided by Wells). Device must be installed in accordance with local codes and authorities having jurisdiction. iurisdiction.

TO WIRE:

1. Final connection is accomplished by bringing proper power supply leads (see 'WIRING REQUIREMENTS' label) through conduit knockout to terminal block supplied within the Master Control Panel. Check nameplates for voltage and phase.

NOTE: INSTALLATION MUST MEET LOCAL PLUMBING AND ELECTRICAL CODES.

